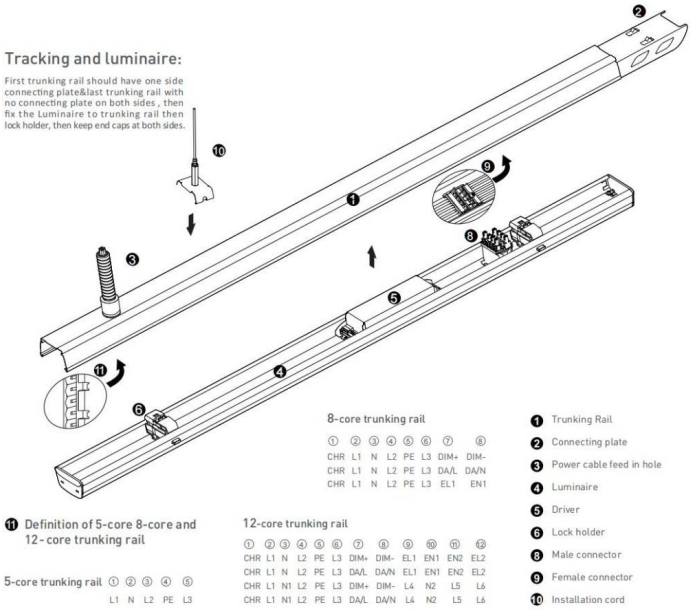
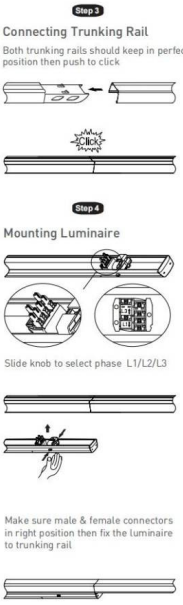
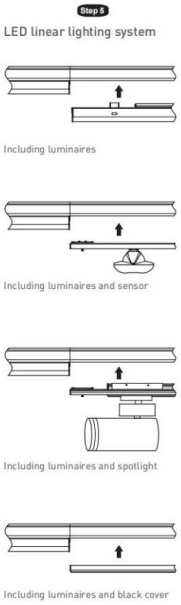
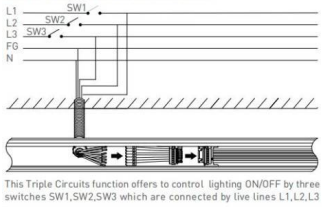




Tracking and luminaire:
First trunking rail should have one side connecting plate&last trunking rail with no connecting plate on both sides , then fix the Luminaire to trunking rail then lock holder, then keep end caps at both sides.
8-core trunking rail
① ② ③ ④ ⑤ ⑥ ⑦ ⑧
CHR L1 N L2 PE L3 DIM+ DIM-
CHR L1 N L2 PE L3 DA/L DA/N
CHR L1 N L2 PE L3 EL1 EN1
⓫ Definition of 5-core 8-core and 12- core trunking rail
5-core trunking rail ① ② ③ ④ ⑤
L1 N L2 PE L3
12-core trunking rail
① ② ③ ④ ⑤ ⑥ ⑦ ⑧ ⑨ ⑩ ⑪ ⑫
CHR L1 N L2 PE L3 DIM+ DIM- EL1 EN1 EN2 EL2
CHR L1 N L2 PE L3 DA/L DA/N EL1 EN1 EN2 EL2
CHR L1 N1 L2 PE L3 DIM+ DIM- L4 N2 L5 L6
CHR L1 N1 L2 PE L3 DA/L DA/N L4 N2 L5 L6
❶ Trunking Rail
❷ Connecting plate
❸ Power cable feed in hole
❹ Luminaire
❺ Driver
❻ Lock holder
❽ Male connector
❾ Female connector
❿ Installation cord


Step 1
Mounting Suspension
Adjust length of suspension cord:
a. press down Hexagon bolt;
b. Pull in/out cord to adjust length
Click
Click in mounting clip into trunking rail
Step 2
Connecting Power Supply
Put in conduit with cable inside and pull up conduit gland to lock
Connect wires according labeling on wires to feed in connector then connect to connector in trunking rail


Step 3
Connecting Trunking Rail
Both trunking rails should keep in perfect position then push to click
Click
Step 4
Mounting Luminaire
Slide knob to select phase L1/L2/L3
Make sure male & female connectors in right position then fix the luminaire to trunking rail


Step 5
LED linear lighting system
Including luminaires
Including luminaires and sensor
Including luminaires and spotlight
Including luminaires and black cover


Wire diagram of triple circuits function
L1
L2
L3
FG
N
SW1
SW2
SW3
This Triple Circuits function offers to control lighting ON/OFF by three switches SW1,SW2,SW3 which are connected by live lines L1,L2,L3

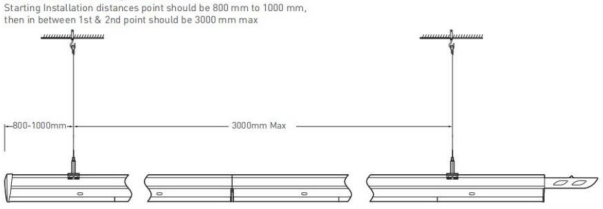

Pendant and mounting installation
Starting Installation distances point should be 800 mm to 1000 mm, then in between 1st & 2nd point should be 3000 mm max
800-1000mm
3000mm Max


Four options for installation
Surfacing mounting kit
Rod hanger
Cord hanger
Chain hanger

Safety notes:

Installation should be performed only by qualified electrician .


- Make sure no voltage while installation .
- Connect cable wires according to wire labeling.
- Max current should not exceed 16A in one power feed in circuit.

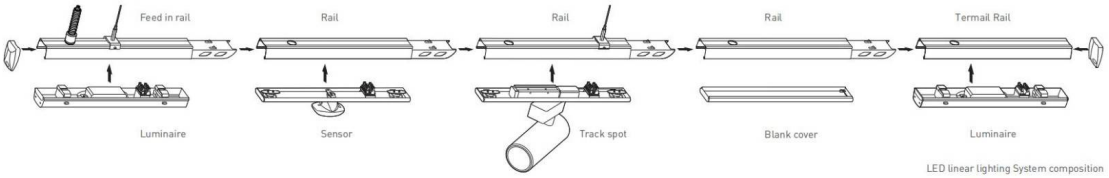

LED linear lighting System composition

Terminal module:

Terminal module can be independently installed as a single unit, it also can be connected at end of one linear light row.

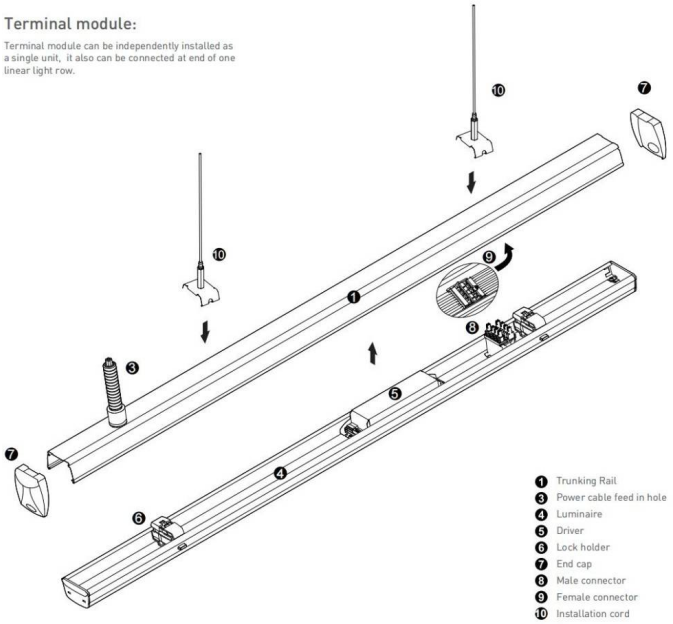

1. Trunking Rail
3. Power cable feed in hole
4. Luminaire
5. Driver
6. Lock holder
7. End cap
8. Male connector
9. Female connector
10. Installation cord


Step 1


Mounting Suspension

Drill a hole on ceiling




Fix mounting hook into ceiling

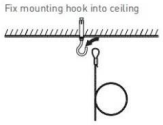

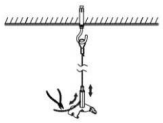

Adjust length of suspension cord:
a. press down Hexagon bolt;
b. Pull in/out cord to adjust length



Click in mounting clip into trunking rail

Step 2


Connecting Power Supply



Cut the Rubber cap to pass the power cable



Screw in the conduit gland

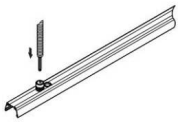


Put in conduit with cable inside and pull up conduit gland to lock




Connect wires according labeling on wires to feed in connector then connect to connector in trunking rail

Step 3

Mounting Luminaire



Slide knob to select phase L1/L2/L3

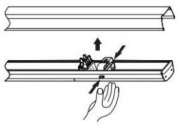

Make sure male & female connectors in right position then fix the luminaire to trunking rail



Push the sliding lock to lock the luminaire to trunking rail